


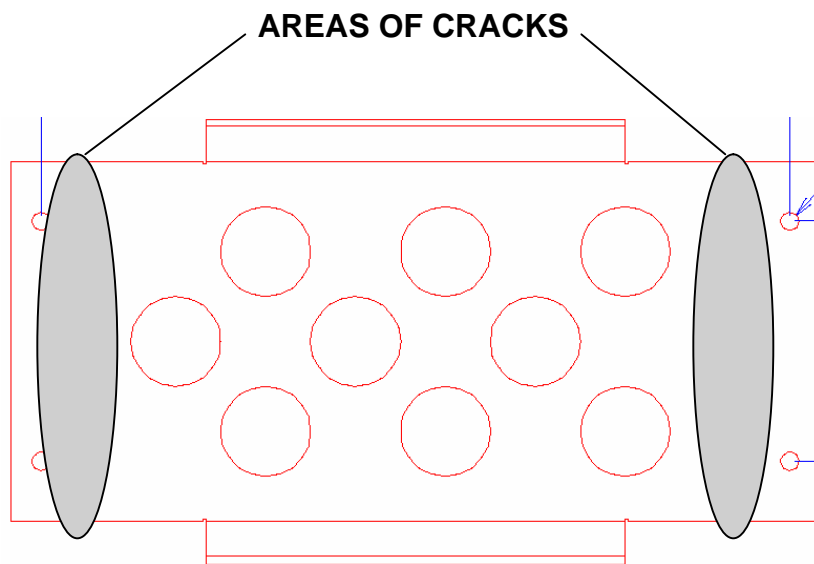
**SERVICE INFORMATION LETTER 012**

December 10, 2004

Subject: Shadin ADC-2000 Tray Inspection

This Service Information Letter is to inform all operators of a potential failure of the Shadin ADC-2000 tray assembly, P/N 612826.

There have been reports from the field of cracking found on the aluminum mounting tray around the bend radius of the tray assembly. Every operator should inspect the mounting tray as soon as possible, then at a minimum of every annual inspection to determine if the tray has developed cracks. If cracks are found, the tray assembly shall be replaced at the earliest convenience.



Robert DuRall  
Manager, Avionic Service Dept.  
Chelton Flight Systems